

Service Bulletin

Bulletin No.: 18-NA-359

Date: October, 2019

INFORMATION

Subject:

Information on Flashing "D" in PRNDL and/or Transmission Slip/Flare on 1-2 Upshift with Zero to Very Light Throttle Input

This bulletin replaces PIP5611. Please discard PIP5611.

Brand:	Model:	Model Year:		VIN:		Engino	Transmission:
		from	to	from	to	Engine:	(Automatic)
Buick	Enclave	2018	2020				9T60 (RPO
	LaCrosse		2019				M3G) or 9T65 (RPO M3W)
Cadillac	XT4	2019	2020				9T50 (RPO M3H)
	XT5	2020					
	XT6						9T50 (RPO
GMC	Acadia						M3H) or eta (RPO M3U)
	Terrain	2018					

Involved Region or Country	United States, Canada, Mexico, Middle East, Israel, Europe, Russia, Japan, South Korea			
Condition	Some customers may comment that the Driver Information Center (DIC) may intermittently flash the "D" in the PRNDL and/or a transmission flare/slip 1-2 shift at zero to very light throttle.			
Information	During a zero to very light throttle 1-2 shift, the transmission performs a Neutral shift to aid in release of the selectable one-way clutch. The DIC display will momentarily change the "D" display to a Shift in Progress display ("D" with a white boxed background), resulting in the flashing "D." During this shift event, the scanned power flow state will momentarily indicate Neutral.			
mormation	Note: Any time Drive is being commanded and the engaged power flow state does not indicate Drive, then the ETRS range master will send "shift in progress" to the IPC.			
	This is a normal operating condition. No repairs are recommended for this concern. This condition does not affect transmission durability.			

Parts Information

No parts are required for this repair.

Version	2
Modified	Released November 29, 2018
	October 21, 2019 – Added the 2020 Model Year, added the Acadia, XT5 and XT6 models and updated the Involved Region or Country section.



